

INSTRUCTION MANUAL




KEPCO An ISO 9001 Company.

**KIT
DIN GE
-35/50S**

DIN-RAIL MOUNTING KIT FOR SERIES GE-35S, GE-50S

DESCRIPTION. Kepco KITS, Models DIN GE-35S and GE-50S each contain two mounting clips and associated hardware used to install GE-35 and GE-50 Series power supplies on a DIN rail. The "S" suffix is for mounting horizontally along the short dimension (width) as shown in Figure 1. Outline dimensions are shown in Figure 4.

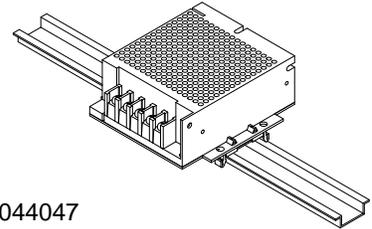

3044047

FIGURE 1. S SUFFIX ORIENTATION

TABLE 1. COMPONENTS SUPPLIED

KIT MODEL NO.	MOUNTING PLATE (QTY 1) PART NO.	CLIP (QTY 2) PART NO.	FLAT WASHER (QTY 2) PART NO.	SCREW (QTY 2) PART NO.
DIN GE-35S DIN GE-50S	189-0920	108-0365	103-0014 (NO. 4)	101-0434 (M3 x 8, RNPH)

INSTALLING KIT. Attach the mounting plate to the power supply using the hardware supplied (see Figure 3). Then snap the clips into the mounting plate as shown in Figure 3.

INSTALLING POWER SUPPLY ON DIN RAIL. To mount the power supply on the rail insert one end of both clips under one edge of the rail, then snap the other end of the two clips into place (see Figure 2A).

REMOVING POWER SUPPLY FROM DIN RAIL. While grasping the power supply with one hand, use a screwdriver to apply leverage towards the left as shown in Figure 2B to disengage each clip from the rail. Where mounting clips are close together, it may be necessary to apply leverage with two screwdrivers simultaneously.

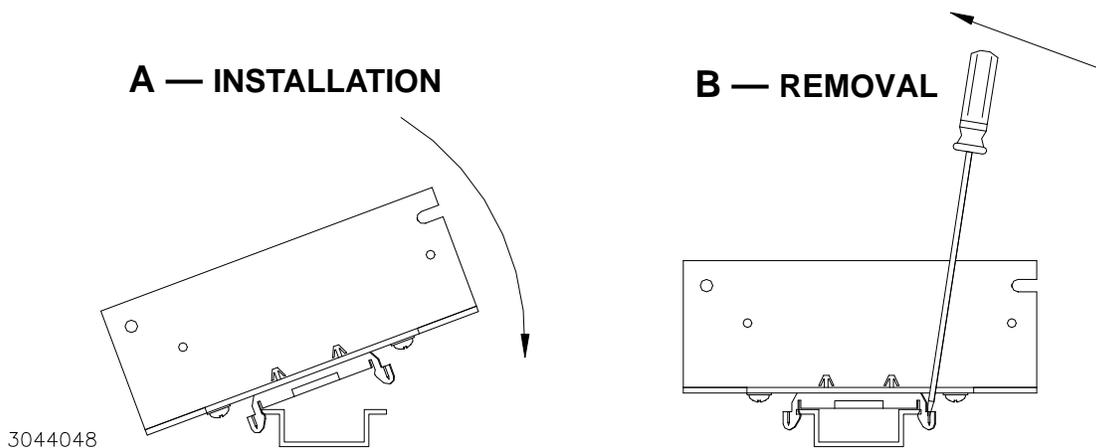


FIGURE 2. INSTALLATION AND REMOVAL OF POWER SUPPLY FROM DIN RAIL

KEPCO, INC. ● 131-38 SANFORD AVENUE ● FLUSHING, NY. 11355 U.S.A. ● TEL (718) 461-7000 ● FAX (718) 767-1102
<http://www.kepcopower.com> ● email: hq@kepcopower.com

3044049

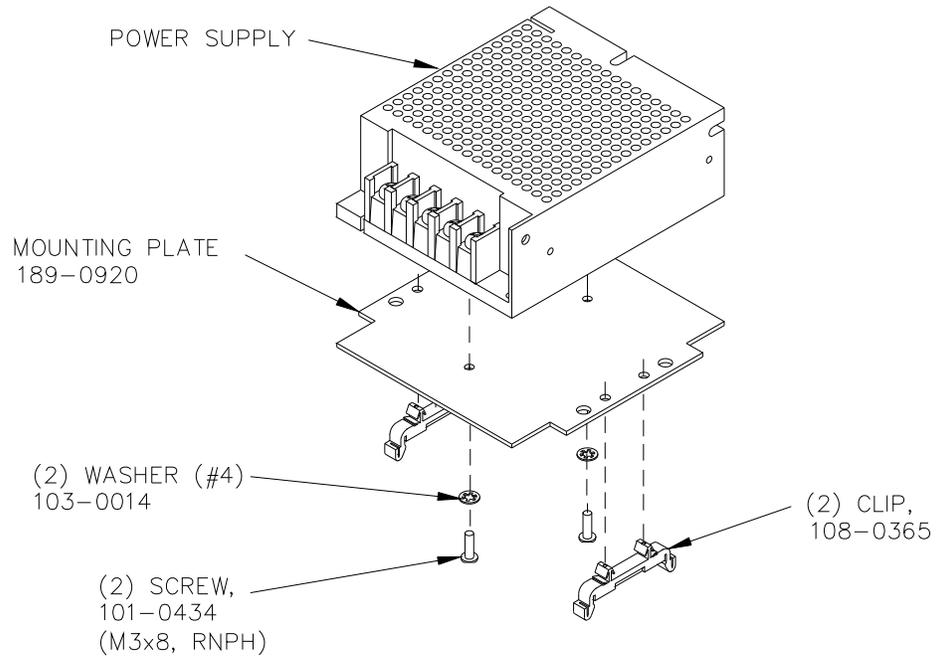


FIGURE 3. INSTALLATION OF KIT ON POWER SUPPLY

3044050

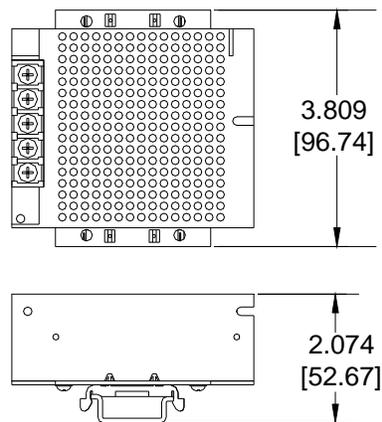


FIGURE 4. POWER SUPPLY WITH KIT INSTALLED, OUTLINE DIMENSIONS